



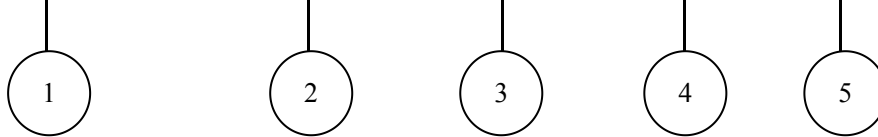

常州金信诺凤市通信有限公司

N Connectors for KSR400 Coaxial cable N 型配接 KSR400 电缆连接器


NM-KSR400 Connector
NM-KSR400 连接器
零部件清单 /Parts list

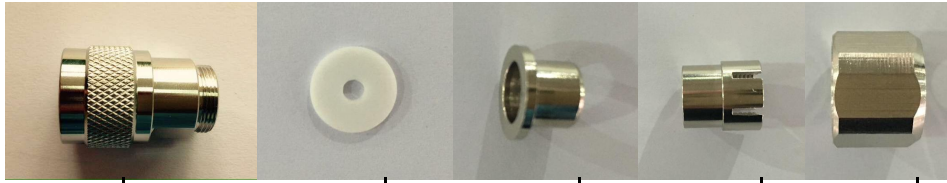

1、连接器主体 Connector body
2、绝缘片 Insulator
3、衬套 Lining
4、线夹 Ferrule
5、螺母 Nut

工具清单/Tools list

刷子 Brush
刀 Knife
尖嘴钳 Pliers
锉刀 File
扳手 (15#) Wrench
扳手(16#) Wrench

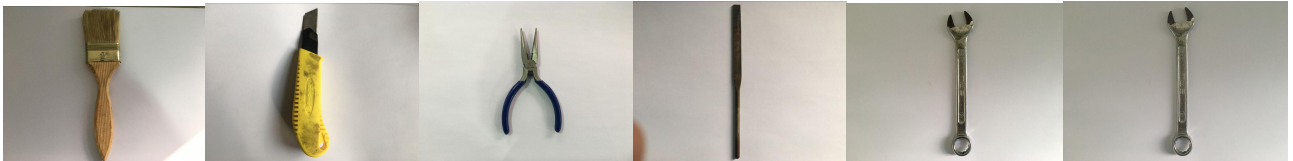

安装步骤:

Assembly Steps




1 按剥线尺寸，用刀划开电缆外皮，并整理电缆屏蔽层。
Cut jacket by knife by stated dimension and trim cable braid.



2 将螺母“5”穿在电缆上。
Slide the nut “5” onto the cable.



3 将线夹“4”套在电缆上，要求线夹推到靠近电缆外皮根部为止。
Slide ferrule “4” onto the cable, and push

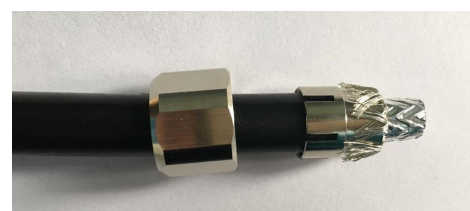

4 翻开电缆屏蔽层。
Splay out outer conductor.




ferrule against the root of cable's jacket.




5 穿入衬套“3”。

Lining “3” rip onto cable.

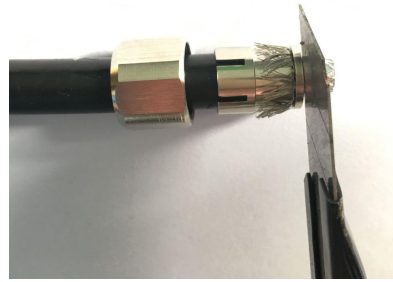


6 沿衬套端面将铝箔层和绝缘介质切除。

Excise aluminum foil and dielectric along Lining's surface.

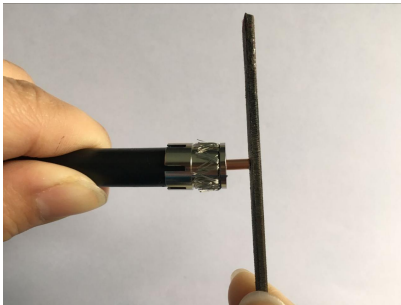


7 锥削内导体，并去除残渣。

Taper inner conductor and remove debris.

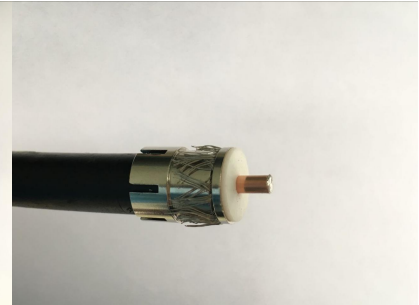

8 将绝缘片“2”推至衬套端面，并贴紧衬套。

Push insulator “2” up to clamp, and press close to clamp.

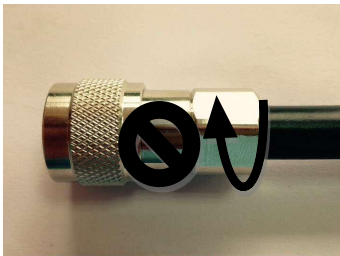

9 将准备好的电缆穿入连接器主

体“1”，并按图示方向，手动旋合螺母直到手旋不动为止。

Insert the prepared cable into the connector body “1”, Mate assembly parts for connector body and nut with nut until stop by hand see the pic.



10 按图示方向用扳手紧固连接器壳体。

至完全闭合（力矩为 5.0 N.m）。

Tighten connector body firmly by wrenches until stop see the pic. (torque force is 5.0 N.m)



11 装接完成。

Finish assembly.